

Standard Installation

ORION KNUCKLE SLIPFITTER MOUNT



Flammable



Warning



High Voltage



Hot Surface

TOOLS NEEDED:



Waterproof Wire Connectors



Adjustable Crescent Wrench



Flat Head Screwdriver



TORX T27 Tamper Resistant 1/4" Bit

INSTRUCTIONS PERTAINING TO A RISK OF FIRE, OR INJURY TO PERSONS IMPORTANT SAFETY INSTRUCTIONS

Lighted fixture is HOT! WARNING - To reduce the risk of FIRE OR INJURY TO PERSONS:

Turn off/unplug and allow to cool before replacing lamp/LED. Fixture gets HOT quickly! Contact only switch/plug when turning on. Do not touch hot lens, guard, or enclosure. Keep fixture away from materials that may burn. Do not operate the luminaire fitting with a missing or damaged shield. Do not touch the source at any time. Use a soft cloth or gloves. Oil from skin may cause damage.


SAVE THESE INSTRUCTIONS

IMPORTANT SAFETY INFORMATION - READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS

- Product must be installed by a qualified person in a manner consistent with its intended use and in compliance with the National Electrical Code, Canadian Electrical Code, and all Local and Provincial Codes.
- Follow product label information and instructions.
- Qualified Personnel with appropriate personal protective equipment must perform all servicing of this product.
- Before wiring to power supply and during servicing, turn off and lock out power at fuse or circuit breaker before service.
- The use of accessory equipment not recommended by the manufacturer or installed contrary to instructions may cause an unsafe condition. The use of damaged components may cause an unsafe condition and void product warranty.
- Do not block light emanating from product in whole or part, as this may cause an unsafe condition.
- Never operate the fixture with missing or damaged lens. Lens must be cleaned on regular basis.
- Entire fixture may become extremely hot. Do not touch hot lens or fixture body.
- Replace LED assembly only with correct wattage and type of power supply appropriate for LED assembly.
- All gaskets, o-rings and sealing surfaces must be kept clean during installation and service; failure to do this may cause an unsafe condition and void product warranty.

IMPORTANT LISTINGS AND CERTIFICATIONS

- Suitable for wet locations

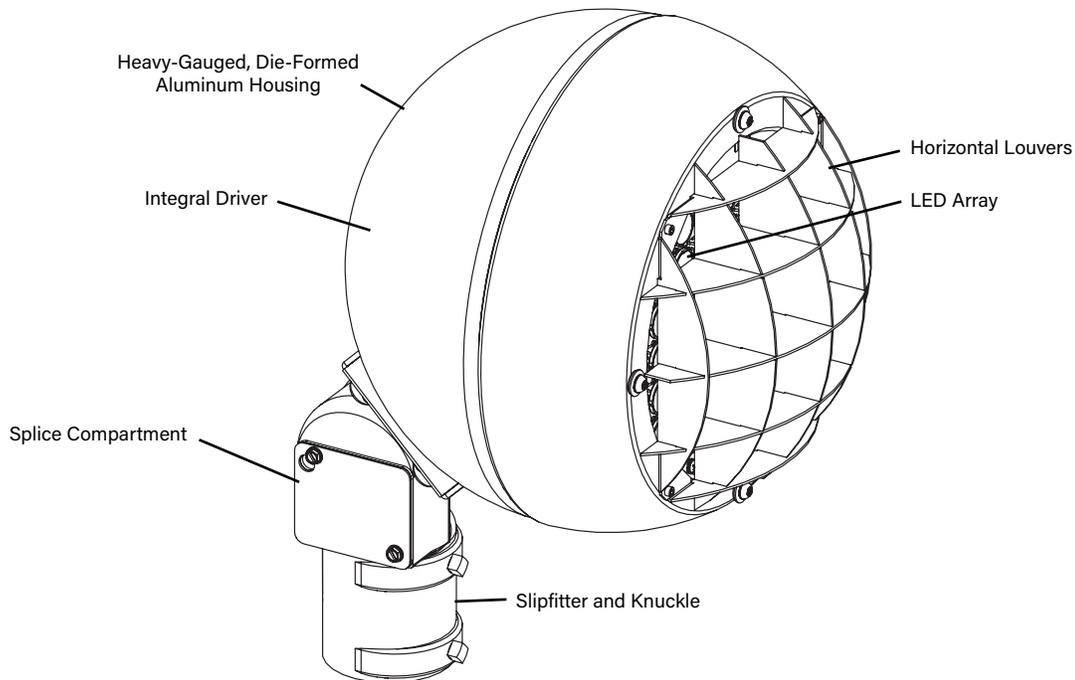

ORION - KNUCKLE SLIPFITTER MOUNT

IMPORTANT SAFETY INFORMATION - READ, FOLLOW, AND SAVE THESE INSTALLATION INSTRUCTIONS


B-K LIGHTING

4029 Brickyard Drive • Madera, CA 93636 • USA
559.438.5800 • FAX 559.438.5900
www.bklighting.com • info@bklighting.com

RELEASE DATE
06/27/2023


REFERENCE NUMBER
INS-2506-06

THIS DOCUMENT CONTAINS PROPRIETARY INFORMATION OF B-K LIGHTING, INC. AND ITS RECEIPT OR POSSESSION DOES NOT CONVEY ANY RIGHTS TO REPRODUCE, DISCLOSE ITS CONTENTS, OR TO MANUFACTURE, USE OR SELL ANYTHING IT MAY DESCRIBE. REPRODUCTION, DISCLOSURE OR USE WITHOUT SPECIFIC WRITTEN AUTHORIZATION OF B-K LIGHTING, INC. IS STRICTLY FORBIDDEN.

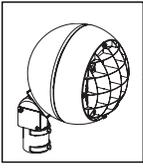


Standard Installation


ORION KNUCKLE SLIPFITTER MOUNT

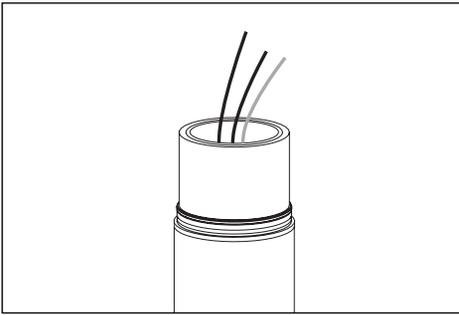

1. Pull branch circuit wiring needed, through pole tenon.

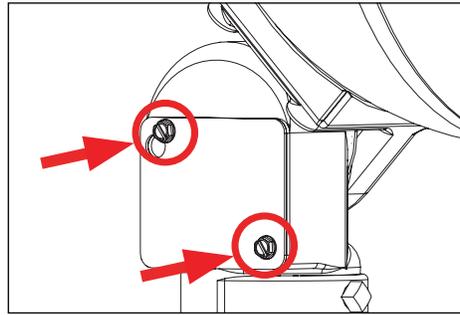


2. Remove wiring compartment access panel to knuckle wiring compartment by loosening two (2) screws using a 5/16" socket wrench.

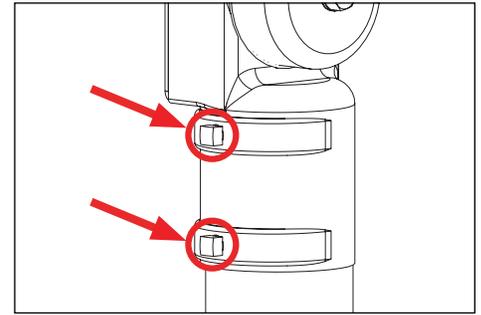

3. Fit fixture over pole on mounting plate and ensure it is completely seated. Secure fixture to pole by tightening two (2) 3/8"x16 stainless steel square screws using an adjustable crescent wrench.


Access to wiring connections is through panel on slipfitter knuckle.

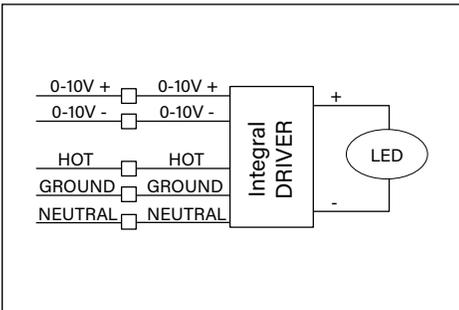


WIRING DIAGRAM

4. Make watertight connections using waterproof wire connectors to connect incoming primary wiring to integral driver wiring as per NEC. Secondary side is factory wired.

⚠ All line voltage connections must be made in compliance with the National Electrical Code. Failure to do so will void warranty.

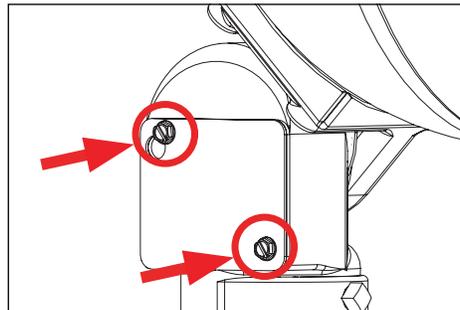

5. Attach wiring compartment access panel to knuckle wiring compartment by tightening two (2) screws using a 5/16" socket wrench.

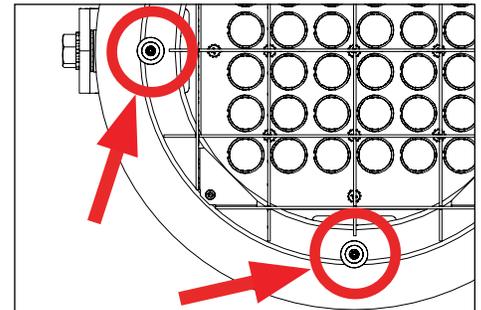

6. To relamp: remove faceplate and louver by loosening four (4) tamper resistant screws using a TORX T27 socket (1/4" bit). Relamp as needed, then reverse install.

**IMPORTANT SAFETY INFORMATION LISTED ON REVERSE
READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS**



B-K LIGHTING

40429 Brickyard Drive • Madera, CA 93636 • USA
559.438.5800 • FAX 559.438.5900
www.bklighting.com • info@bklighting.com

RELEASE DATE
06/27/2023

REFERENCE NUMBER
INS-2506-06